

Cold Shrink Silicone Rubber Termination QT-III

(With High-K Stress Relief)


Instructions


IEEE Std. No. 48-1990

Class 1 Termination 35 kV Class 200 kV BIL

Kit Contents:

- 1 Hi-K, Tracking Resistant, Silicone Rubber Termination
- 2 Strips Sealing Mastic (black with white release liners, bagged)
- 1 Instruction Sheet

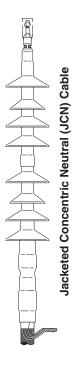

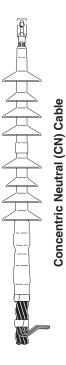


Kit Selection Chart

NOTE: Final Determination Factor is cable insulation diameter.

Kit	Primary Insulation	Jacket	Conductor Size Range (AWG & kcmil)				
Number	O.D. Range	O.D. Range	15 kV	25/28 kV	35 kV		
7663-S-8	0.72" - 1.29" (18,3 - 32,8 mm)	1.04" - 1.60" (26,4 - 40,6 mm)	2/0 - 300 (70 - 150 mm ²)	2 – 4/0 (35 – 120 mm ²)	2 – 2/0 (35 – 70 mm ²)		

Table 1

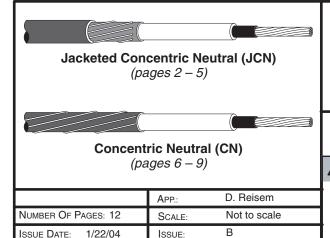

3M[™] Silicone Rubber Outdoor Skirted Termination Kit QT–III for Jacketed Concentric Neutral (JCN) Cable and Concentric Neutral (CN) Cable 7663-S-8

78-8119-6023-2

△CAUTION

Working around energized high-voltage systems may cause serious injury or death. Installation should be performed by personnel familiar with good safety practice in handling high-voltage electrical equipment. De-energize and ground all electrical systems before installing product.

Instructions for Jacketed Concentric Neutral (JCN) Cable


A. Prepare Cable

- 1. Check to be sure cable size fits within kit size range as shown in *Table 1 (cover page)*.
- 2. Train cable into position and cut to length required for installation. Allow sufficient neutral wire length for grounding connection.
- **3.** Prepare cable using dimensions shown in (*Figure 1*) refer to (*Table 2*) for semi-con cutback dimension. **Be sure to allow for depth of terminal lug.**


Kit Number	Insulation O.D. 15 kV AWG / kcmil		25/28 kV AWG / kcmil	35 kV AWG / kcmil	Semi-Con Cutback	
7663-S-8	0.72"– 1.08"	2/0 - 4/0	2 – 2/0	2 – 1	13.5"	
	(18,3 – 27,4 mm)	(70 - 120 mm ²)	(35 – 70 mm ²)	(35 mm ²)	(342,9 mm)	
7000 0 0	0.88" - 1.29"	250 - 300	3/0 - 4/0	1/0 - 2/0	13.0"	
	(22,3 - 32,8 mm)	(125 - 150 mm ²)	(95 - 120 mm ²)	(50 - 70 mm ²)	(330,2 mm)	

Table 2

NOTE: Provide additional 1/4" (6 mm) exposed conductor distance to account for growth during crimping of ALUMINUM lugs or connectors.

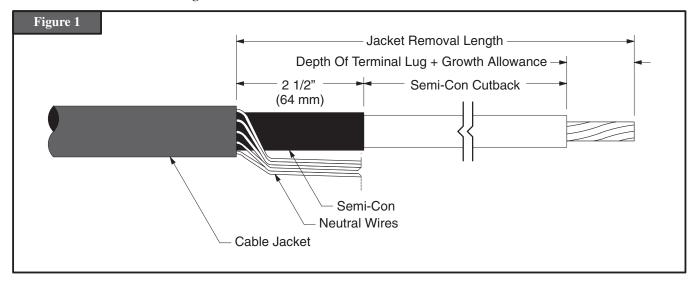

4. Select one of two mastic strips from kit and remove white release liners. Using light tension apply a single wrap of mastic around the cable jacket 1/4" (6 mm) from cut edge (*Figure 2*). Cut off excess.

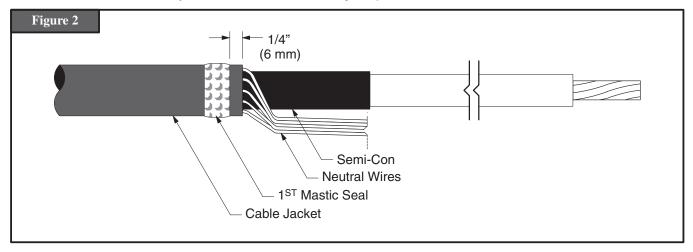

2


78-8119-6023-2

A. Prepare Cable (continued)

5. Bend neutral wires back over applied sealing mastic and secure to cable jacket 4.5" (114 mm), below cable semi-con edge using vinyl tape (*Figure 3*).


NOTE: Position vinyl tape with care, it also serves as a marker for positioning the termination.

- **6.** Select second mastic strip from kit and remove white release liners. Apply a second mastic band over the neutral wires and previously applied mastic (*Figure 3*). Cut off excess.
- 7. Compress neutral wires into mastic by over-wrapping seal strips with two highly stretched layers of electrical grade vinyl tape (*Figure 3*). Be sure to cover all exposed mastic.

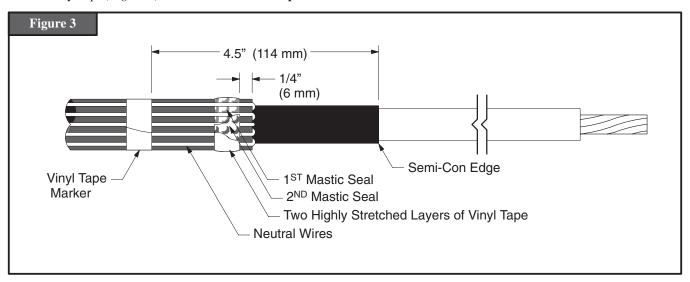

B. Install Lug or Connector

1. Check to insure 3M[™] Termination Assembly QT–III fits over the selected lug. If lug (*Figure 4*) will not fit through the termination core, clean the insulation (*per Step C*) and slide termination on cable before installing lug. **Do not remove core at this time**.

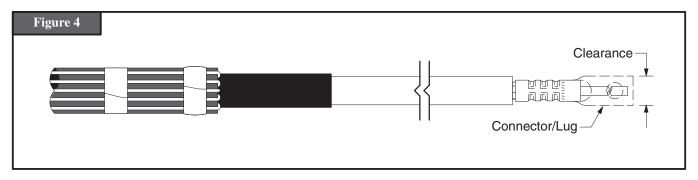

NOTE: Refer to pages 8 and 9 for lug/connector crimping information.

2. Position connector/lug and crimp according to manufacturer's directions. Remove excess oxide inhibitor and sharp crimp flashings following crimping.


C. Clean Cable Insulation and Lug Barrel Using Standard Practice

- 1. Wipe the cable insulation with an approved solvent. Do not allow solvent to touch semi-con insulation shield!
- **2.** If abrasive must be used:
 - a. Use on insulation only. Do not use abrasive on semi-con insulation shield!
 - **b.** Use only aluminum oxide abrasive; grit 120 or finer.
 - c. Be careful not to reduce the cable insulation diameter below that allowed by the kit.


D. Install Termination


1. Slide the termination body onto the cable and remove core. Pull while unwinding counter-clockwise starting with the loose end (*Figure 5*). Make sure the termination body (not the core) is butted up to the edge of the vinyl tape marker previously applied (*Figure 5*).

NOTE: Once the termination insulator has made contact over the mastic seal area, there is no need to continue supporting the assembly. Do not push or pull on the termination assembly while unwinding the core.

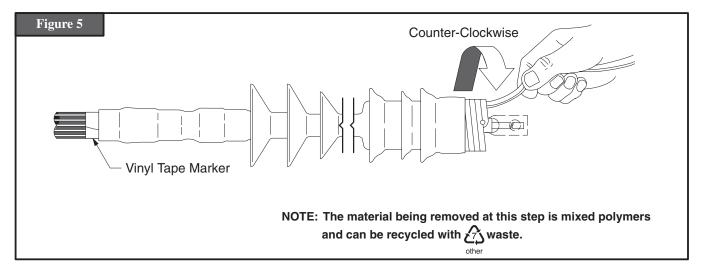

- 2. When using a short barrel lug or connector on smaller size cable it may be necessary to trim any excess termination insulator from the lug or connector.
- 3. Collect all concentric neutral wires together (Figure 6) and connect to system ground according to standard practice.

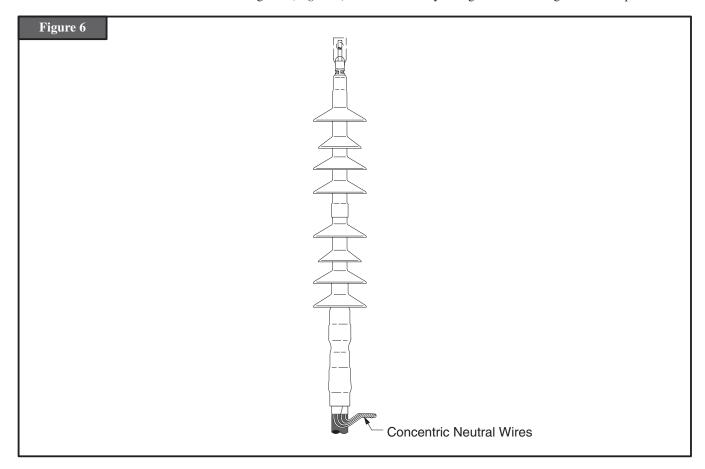

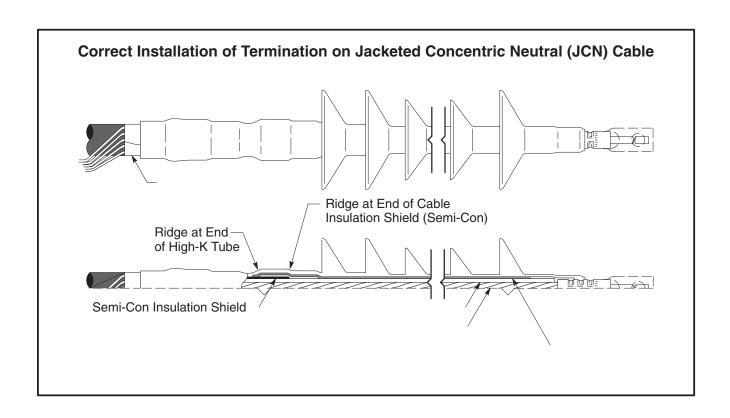

Instructions for Concentric Neutral (CN) Cable

A. Prepare Cable


- 1. Check to be sure cable size fits within kit size range as shown in *Table 1 (cover page)*.
- 2. Train cable into position and cut to length required for installation. Allow sufficient neutral wire length for grounding connection.
- **3.** Prepare cable using dimensions shown in (*Figure 1*) refer to (*Table 3*) for semi-con cutback dimension. **Be sure to allow for depth of terminal lug.**

Kit Number	Insulation O.D.	15 kV AWG / kcmil	25/28 kV AWG / kcmil	35 kV AWG / kcmil	Semi-Con Cutback	
7663-S-8	0.72" - 1.08"	2/0 - 4/0	2 – 2/0	2 – 1	13.5"	
	(18,3 - 27,4 mm)	(70 - 120 mm ²)	(35 – 70 mm ²)	(35 mm ²)	(342,9 mm)	
7000 0 0	0.88" - 1.29"	250 – 300	3/0 - 4/0	1/0 – 2/0	13.0"	
	(22,3 - 32,8 mm)	(125 – 150 mm ²)	(95 - 120 mm ²)	(50 – 70 mm ²)	(330,2 mm)	

Table 3

NOTE: Provide additional 1/4" (6 mm) exposed conductor distance to account for growth during crimping of ALUMINUM lugs or connectors.

- **4.** Secure neutral wires to cable with several highly stretched layers of electrical grade vinyl tape around the cable and neutral wires 2 3/4" (69,9 mm) from cut edge of cable semi-con (*Figure 7*).
- **5.** Select one of two mastic strips from kit and remove white release liners. Using light tension, wrap a band of mastic around the cable and neutral wires 2 3/4" (69,9 mm) from cut edge of cable semi-con, directly on top of vinyl tape (*Figure 7*). Cut off excess.

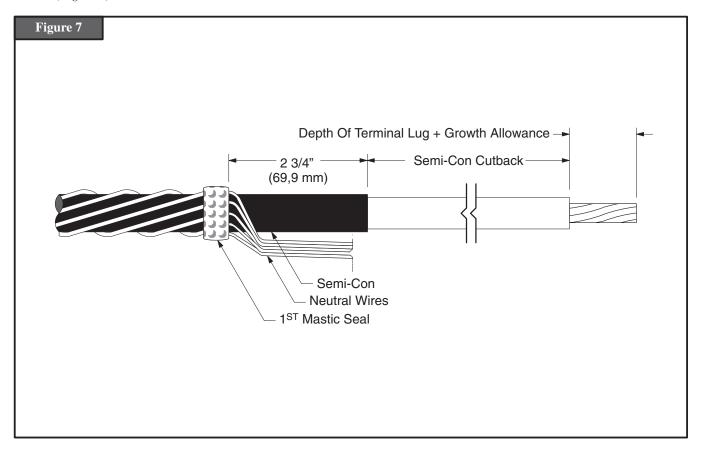


6

A. Prepare Cable (continued)

6. Bend neutral wires back over applied sealing mastic and secure to cable 4.5" (114 mm), below cable semi-con edge using vinyl tape (*Figure 8*).


NOTE: Position vinyl tape with care, it also serves as a marker for positioning the termination.

- 7. Select second mastic strip from kit and remove white release liners. Apply a second mastic band over the neutral wires and previously applied mastic (*Figure 8*). Cut off excess.
- **8.** Compress neutral wires into mastic by over-wrapping seal strips with two highly stretched layers of electrical grade vinyl tape (*Figure 8*). **Be sure to cover all exposed mastic.**

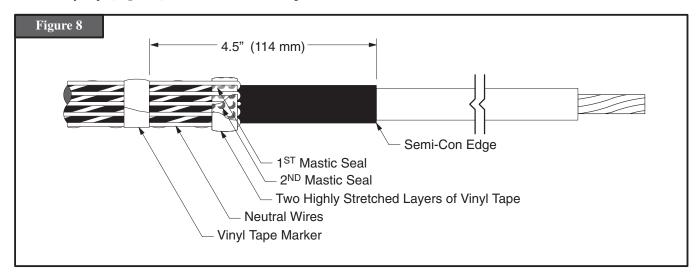

B. Install Lug or Connector

1. Check to insure termination assembly fits over the selected lug. If lug (*Figure 9*) will not fit through the termination core, clean the insulation (*per Step C*) and slide termination on cable before installing lug. **Do not remove core at this time**.

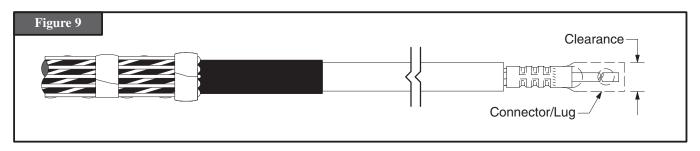

NOTE: Refer to pages 8 and 9 for lug/connector crimping information.

2. Position connector/lug and crimp according to manufacturer,s directions. Remove excess oxide inhibitor and sharp crimp flashings following crimping.


C. Clean Cable Insulation and Lug Barrel Using Standard Practice

- 1. Wipe the cable insulation with an approved solvent. Do not allow solvent to touch semi-con insulation shield!
- 2. If abrasive must be used:
 - a. Use on insulation only. Do not use abrasive on semi-con insulation shield!
 - **b.** Use only aluminum oxide abrasive; grit 120 or finer.
 - c. Be careful not to reduce the cable insulation diameter below that allowed by the kit.


D. Install Termination

1. Slide the termination body onto the cable and remove core. Pull while unwinding, counter-clockwise, starting with the loose end (*Figure 10*). Make sure the termination body (not the core) is butted up to the edge of the vinyl tape marker previously applied (*Figure 10*).


NOTE: Once the termination insulator has made contact over the mastic seal area, there is no need to continue supporting the assembly. Do not push or pull on the termination assembly while unwinding the core.

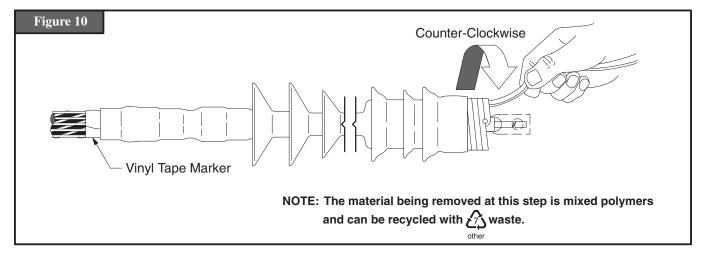

- 2. When using a short barrel lug or connector on smaller size cable it may be necessary to trim any excess termination insulator from the lug or connector.
- 3. Collect all concentric neutral wires together (Figure 11) and connect to system ground according to standard practice.

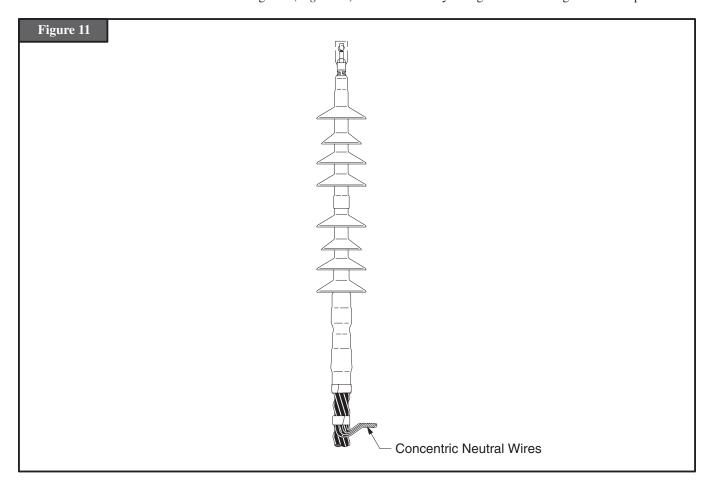

8 78-8119-6023-2

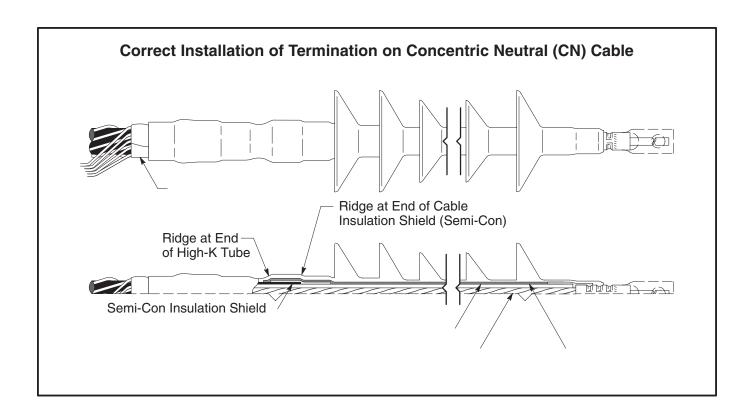

Tooling Index

1/2 1/2

1/2 1/2

1/2 1/2

1/2 5/8 1/2

1/2 1/2

1/2

300

350

400

500

600

750

31053 31153

31056 31156

31060 31160

31066 31067 31166

31068 31168

31172

31178

Lug and Crimping Information for 3M™ Scotchlok™ Copper Lugs												
	14 thru 30 hole	0045	31036 thru 31068 One hole — long barrel						31145 thru 31178 Two hole			
					С	RIMPING TOOL-DIE SET	S (NUMBER OF	CRIMPS)				
Cable Size AWG/	Stud Size (in.)	Scotchlok™ Copper Lug Number		Burnd	ly Corporation		Thoma	s & Betts Corpora	Square D Co. derson Div			
kcmil			MD6	MY29	Y34A	Y35, Y39, Y45*, Y46*	TBM 5	ТВМ 8	TBM 15	VC6-3, VC6-FT**		
6	10 1/4 5/16	30014 30015 30016	_	6AWG(1)	_	U5CRT(1)	Blue(1)	Blue(1)	_	Universal(1)		
4	10 1/4 3/8	30018 30019 30021	W161(1)	4AWG(1)	A4CR(1)	U4CRT(1)	Grey(1)	Grey(1)	_	Universal(1)		
2	1/4 5/16 3/8	30022 30023 30024	W162(2)	2AWG(1)	A2CR(1)	U2CRT(2)	Brown(1)	Brown(1)	33(1)	Universal(2)		
1	5/16 3/8	30027 30028	_	1AWG(1)	A1CR(1)	U1CRT(2)	Green(1)	Green(1)	37(1)	Universal(2)		
1/0	5/16 3/8	30031 30032	W163(2)	1/0(1)	A25R(1)	U25RT(1)	Pink(2)	Pink(2)	42H(2)	Universal(1)		
2/0	3/8 3/8	30036 31036	W241(2) W241(3)	2/0(1) 2/0(2)	A26R(1) A26R(2)	U26RT(2) U26RT(3)	Black(2) Black(3)	Black(2) Black(3)	45(1) 45(2)	Universal(1) Universal(2)		
3/0	1/2 1/2	30041 31041	W243(2) W243(3)	3/0(1) 3/0(2)	A27R(1) A27R(2)	U27RT(2) U27RT(3)	Orange(2) Orange(3)	Orange(2) Orange(3)	50(1) 50(2)	Universal(2) Universal(3)		
4/0	1/2 1/2 1/2	30045 31045 31145	BG(3) BG(4) BG(4)	4/0(1) 4/0(2) 4/0(2)	A28R(2)	U28RT(2) U28RT(3) U28RT(3)	Purple(2) Purple(3) Purple(3)	Purple(2) Purple(3) Purple(3)	54H(2) 54H(3) 54H(3)	Universal(2) Universal(3) Universal(3)		
250	1/2 1/2	31049 31149	W166(4)	250(2)	A29R(2)	U29RT(3)	Yellow(2)	Yellow(2)	62(2)	Universal(2)		

A30R(2)

A31R(2)

A32R(2)

A34R(2)

U30RT(3)

U31RT(3)

U32RT(3)

U34RT(3)

U36RT(3)

Y39, Y45, Y46 U39RT(5)

Y45: S44RT(6) Y46: P44RT(6)

10 78-8119-6023-2

White(3)

Red(4)

Blue(4)

Brown(4)

Green(4)

66(3)

71H(4)

76H(4)

87H(4)

94H(4)

106H(4)

125H(4)

Universal(3)

^{*} Y45 and Y46 accept all Y35 dies ("U" series). For Y45 use PT6515 adapter. For Y46 use PUADP adapter.
** Anderson VC6-3, VC6-FT, VC8C and Burndy Y1000 require no die set.

Tooling Index

	Lug and Crimping Information for 3M™ Scotchlok™ Copper/Aluminum Lugs														
40016 thru 40079 One hole							40132 thru 40178 Two hole								
							CRIMPING	G TOOL-DIE	SETS (NUN	IBER OF C	RIMPS)				
Cable Size AWG/ kcmil	Stud Size (in.)	Scotch- lok™ Lug Number		Bu	rndy Corpora	ation		Tho	omas & Bett	s Corporat	ion	Square D C son I		ITT Black- burn Co.	Kearny Nat'l Div.
Komii		rumber	MD6	MY29	Y34A	Y35, Y39, Y45*, Y46*	Y1000*	ТВМ 5	ТВМ 8	TBM 12	TBM 15	VC6-3** VC6-FT**	VC8C**	OD58	TYPE O
6	5/16	40016	W161(1)	6AWG(1)	A6CAB(1)	U6CABT(1)	(1)	Grey(1)	Grey(1)	-	29(1)	(1)	-	BY19(3)	J(3)
4	5/16	40020	W162(3)	4AWG(1)	A4CAB(1)	U4CABT(1)	(1)	Green(2)	Green(2)	_	37(1)	(1)	_	BY53(3)	P(3)
2	3/8 1/2	40024 40025	W163(3) W163(3)	2AWG(1) 2AWG(1)	A2CAB(1) A2CAB(1)	U2CABT(1) U2CABT(1)	(1) (1)	Pink(2) Pink(2)	Pink(2) Pink(2)	_	42H(2) 42H(2)	(1) (1)	_	BY23(3) BY23(3)	1/2(3) 1/2(3)
1	3/8 1/2	40028 40029	W163(3) W163(3)	1AWG(1) 1AWG(1)	A1CAR(1) A1CAR(1)	U1CART(1) U1CART(1)	(1) (1)	Gold(2) Gold(2)	Gold(2) Gold(2)	_	45(1) 45(1)	(1) (1)	_	BY23(3) BY23(3)	1/2(3) 1/2(3)
1/0	3/8 1/2 3/8	40032 40033 40132	W241(3) W241(3) W241(3)	1/0(1) 1/0(1) 1/0(1)	A25AR(1) A25AR(1) A25AR(1)	U25ART(1) U25ART(1) U25ART(1)	(1) (1) (1)	Tan(2) Tan(2) Tan(2)	Tan(2) Tan(2) Tan(2)	_	50(1) 50(1) 50(1)	(1) (1) (1)	_	BY25(3) BY25(3) BY25(3)	5/8–1(3) 5/8–1(3) 5/8–1(3)
2/0	1/2 1/2	40037 40137	BG(4) BG(4)	2/0(1) 2/0(1)	A26AR(2) A26AR(2)	U26ART(2) U26ART(2)	(1) (1)	Olive(2) Olive(2)	Olive(2) Olive(2)	_	54H(2) 54H(2)	(2) (2)	_	BY31C(3) BY31C(3)	5/8-1(3) 5/8-1(3)
3/0	1/2 1/2	40041 40141	W166(4) W166(4)	3/0(1) 3/0(1)	A27AR(2) A27AR(2)	U27ART(2) U27ART(2)	(1) (1)	Ruby(2) Ruby(2)	Ruby(2) Ruby(2)	_	60(2) 60(2)	(2) (2)	_	_	737(3) 737(3)
4/0	1/2 5/8 1/2	40045 40046 40145	W660(4) W660(4) W660(4)	4/0 (2) 4/0 (2) 4/0 (2)	A28AR(2) A28AR(2) A28AR(2)	U28ART(2) U28ART(2) U28ART(2)	(1) (1) (1)	_	White(4) White(4) White(4)	_	66(4) 66(4) 66(4)	(2) (2) (2)	-	BY35C(4) BY35C(4) BY35C(4)	840(4) 840(4) 840(4)
250	1/2 5/8 1/2	40049 40050 40149	W249(3) W249(3) W249(3)	-	A29AR(2) A29AR(2) A29AR(2)	U29ART(2) U29ART(2) U29ART(2)	(1) (1) (1)	_	_	71H(4) 71H(4) 71H(4)	71H(2) 71H(2) 71H(2)	(3) (3) (3)	-	_	_
300	1/2 1/2	40053 40153	_	_	A30AR(2) A30AR(2)	U30ART(2) U30ART(2)	(1) (1)	_	_	76H(4) 76H(4)	76H(2) 76H(2)	(3) (3)	_	_	_
350	1/2 5/8 1/2	40056 40057 40156	_	_	_	U31ART(2) U31ART(2) U31ART(2)	(1) (1) (1)	_	_	87H(4) 87H(4) 87H(4)	87H(3) 87H(3) 87H(3)	(3) (3) (3)	_	_	_
400	1/2	40160	_	_	_	U32ART(4)	(1)	_	_	94H(4)	94H(4)	_	(2)	_	
500	5/8 1/2	40067 40166	_	_	_	U34ART(4) U34ART(4)	(1) (1)	_	_	106H(4) 106H(4)	106H(3) 106H(3)	_	(2) (2)	_	
600	1/2	40170	_	_	_	U36ART(4)	(1)	-	_	_	115H(3)	_	(3)	_	_
750	5/8 1/2	40073 40172	_	_	_	U39ART(4) U39ART(4)	(1) (1)	_	_	_	125H(5) 125H(5)	_	(3) (3)		
1000	5/8 1/2	40079 40178	_	_	_	S44ART(4) S44ART(4)	(1) (1)	_	_	_	140H(4) 140H(4)	_	(3) (3)	_	_

^{*} Y45 and Y46 accept all Y35 dies ("U" series). For Y45 use PT6515 adapter. For Y46 use PUADP adapter.
** Anderson VC6–3, VC6–FT, VC8C and Burndy Y1000 require no die set.

Tooling Index

3M™ Ste	g Information for m Connectors Aluminum)				
CRIMPING TABLE FOR 3M STEM TYPE CONNECTOR										
Conductor Size	3M Connector Num-			Recommended Crimping T	ools					
Conductor Size	ber	Manufacturer	Mech. Tool	Die (No. Crimps)	Hydraulic	Die (No. Crimps)				
		Burndy	MD6	BG(4), W243(4)	Y35, Y39, Y45**	U25ART(2), U243(2)				
2 Solid 1, 2	SC0002 SC0001 SC0010	Kearny	0–51, 0–52	5/8-1 (4)	12, 20, 40, Ton	5/8-1(4)				
1/0			T & B	TBM 8	Olive(2)	TBM 15	50(2)*			
		Anderson	_	_	VC6	Universal(2)				
		Burndy	MD6	W669(0) 840(5)*	Y35, Y39, Y45**	U28ART(2)				
2/0 3/0 4/0	SC0020 SC0030 SC0040	Kearny	0–51, 0–52	840(5)*	WH-1, WH-2	840(2)				
		T & B	TBM 8	White(4)	TBM 15	66(3)				
		Anderson	-	_	VC6	Universal(2)				

^{*} Y45 and Y46 accept all Y35 dies ("U" series). For Y45 use PT6515 adapter. For Y46 use PUADP adapter.
** Anderson VC6–3, VC6–FT, VC8C and Burndy Y1000 require no die set.

3M and Scotchlok are trademarks of 3M Company.

Important Notice

All statements, technical information, and recommendations related to 3M's products are based on information believed to be reliable, but the accuracy or completeness is not guaranteed. Before using this product, you must evaluate it and determine if it is suitable for your intended application. You assume all risks and liability associated with such use. Any statements related to the product which are not contained in 3M's current publications, or any contrary statements contained on your purchase order shall have no force or effect unless expressly agreed upon, in writing, by an authorized officer of 3M.

Warranty; Limited Remedy; Limited Liability. This product will be free from defects in material and manufacture for a period of one (1) year from the time of purchase. 3M MAKES NO OTHER WARRANTIES INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANT-ABILITY OR FITNESS FOR A PARTICULAR PURPOSE. If this product is defective within the warranty period stated above, your exclusive remedy shall be, at 3M's option, to replace or repair the 3M product or refund the purchase price of the 3M product. Except where prohibited by law, 3M will not be liable for any loss or damage arising from this 3M product, whether indirect, special, incidental or consequential regardless of the legal theory asserted.



Electrical Markets Division

6801 River Place Blvd. Austin, TX 78726-9000 www.3M.com/electrical

